


### FINAL UNIT (X45-391x-xx, X45-398x-xx) Component side view



\*In the service manual, 2 x RK73FB2B471J (470Ω) resistors are listed at the location of R24, R35 instead of the actually mounted C78,C79 (47pF). Please replace these capacitors with 1kΩ resistors.

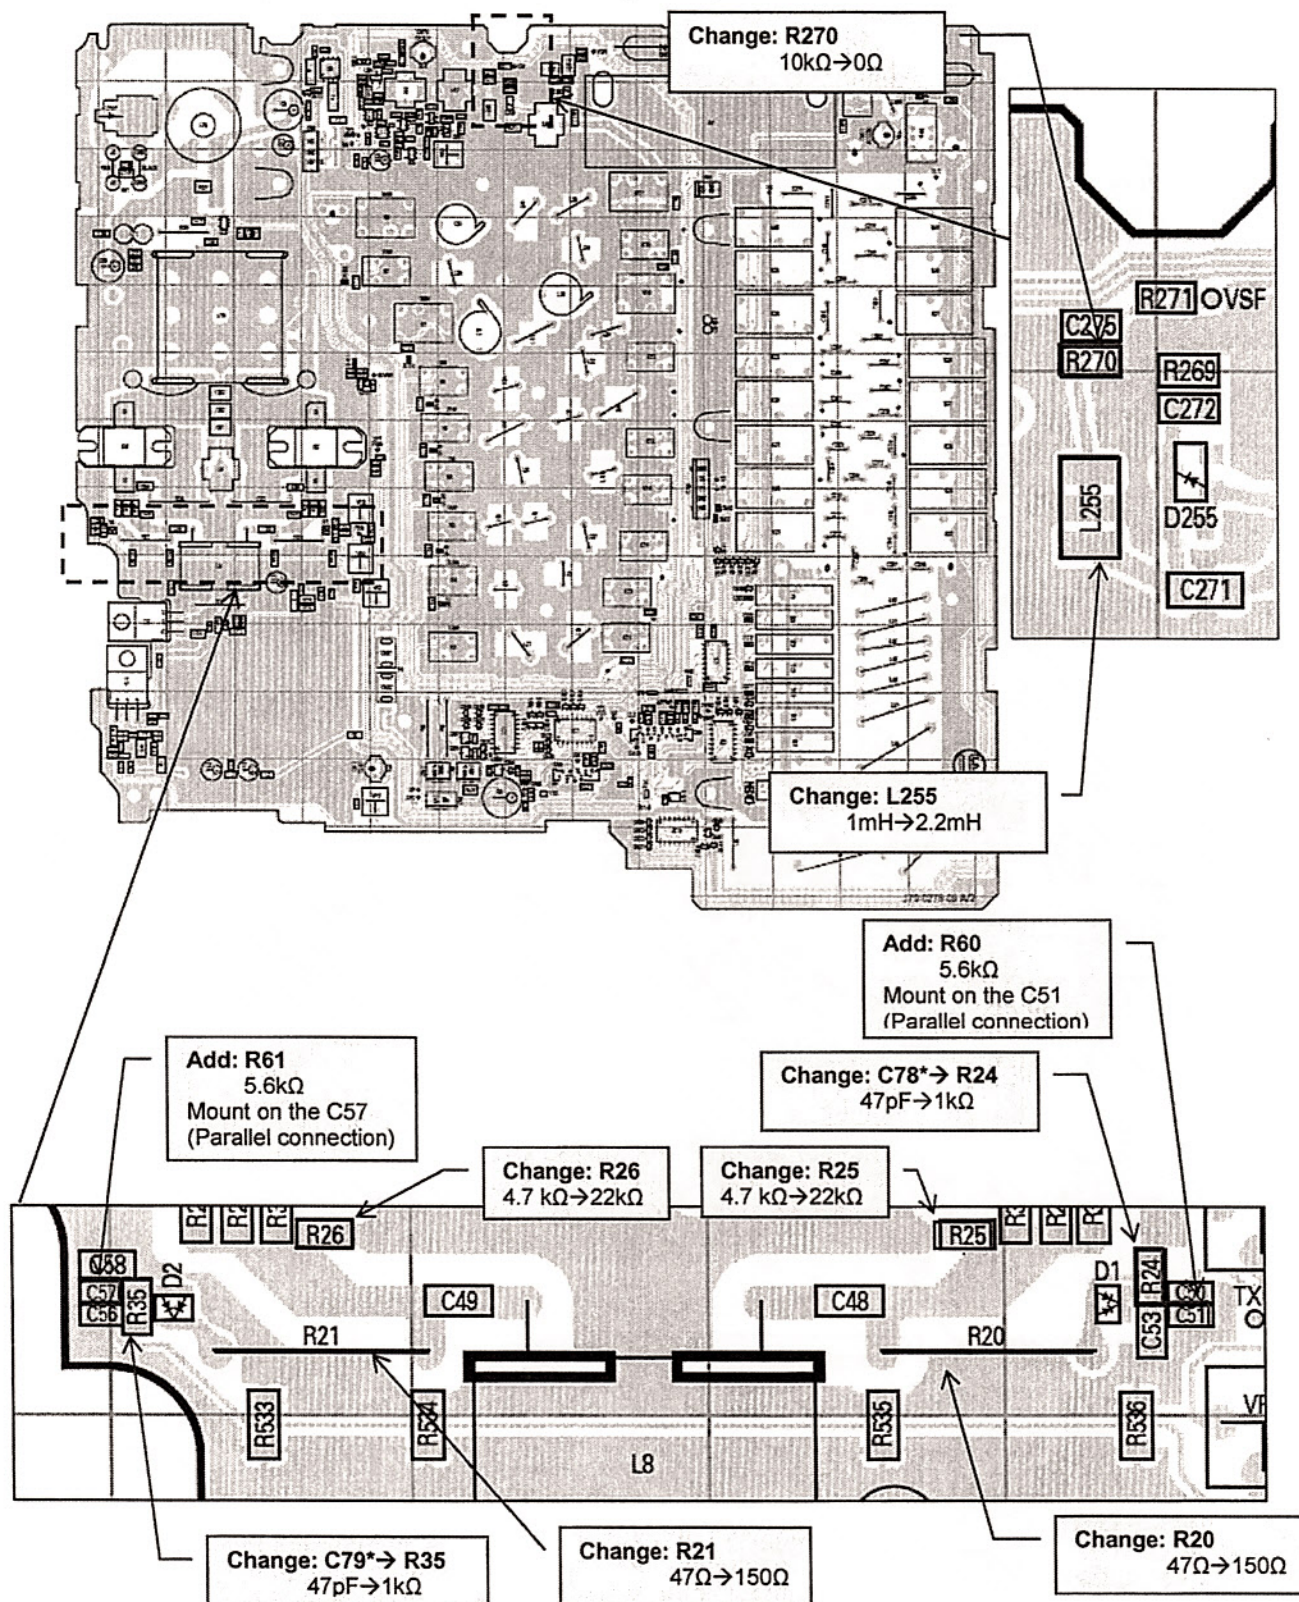

## TX-RX UNIT (X57-785x-xx, X57-861x-xx) Component side view

Change: C810  
10 $\mu$ F  $\rightarrow$  1 $\mu$ F

Delete (Move): C815  
0.047 $\mu$ F  $\rightarrow$  None  
(Do not reuse the removed part for  
the new location of the C815)

Add (Move): C815  
0.047 $\mu$ F  
Mount on the R817  
(Parallel connection)


Change: R825  
100k  $\Omega$   $\rightarrow$  220k

Add: R861  
47 $\Omega$   
(Serial connection with the C830)

Add: Insulation sheet  
F20-3320-04

Add: C830  
0.47 $\mu$ F  
(Serial connection with the R861)

Solder these points

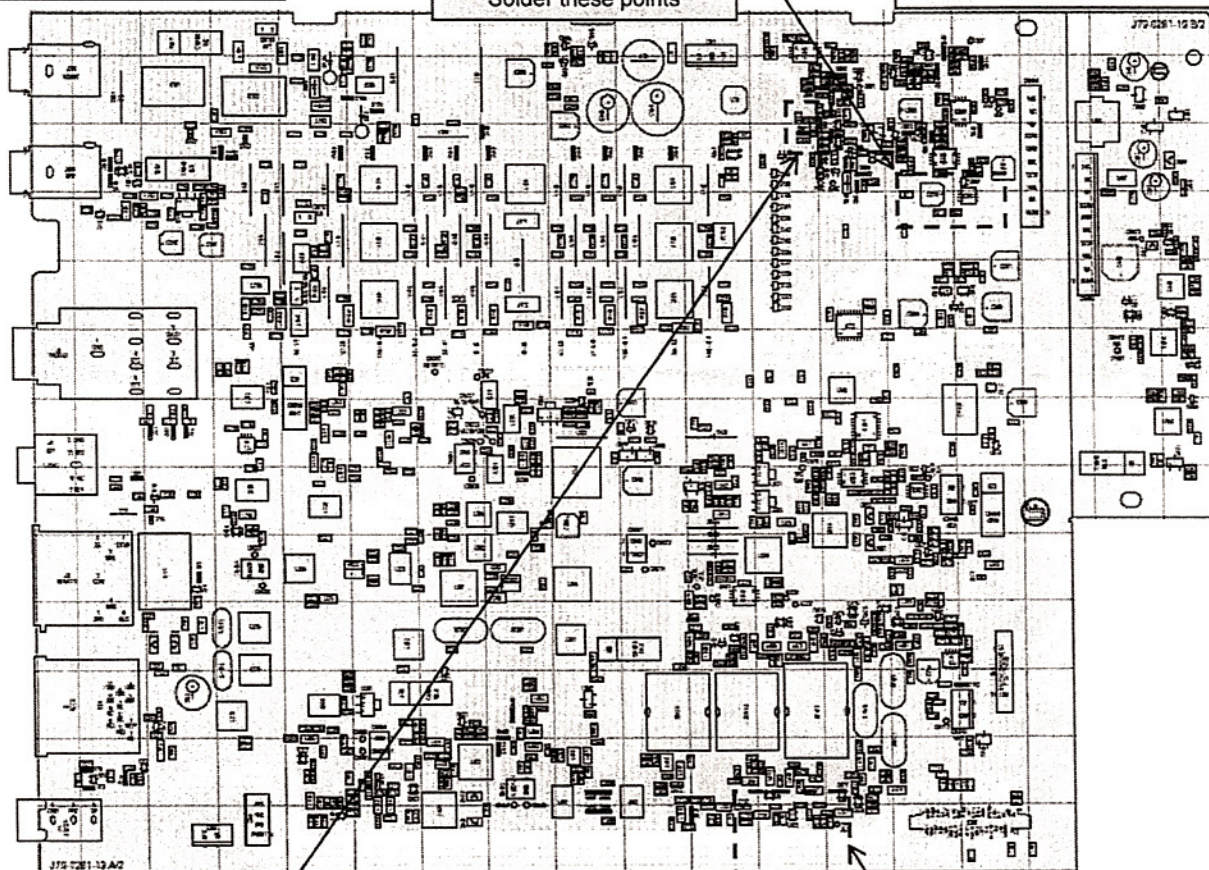

Change: R809  
1.8k $\Omega$   $\rightarrow$  2.2k $\Omega$

Change: R807  
4.7k $\Omega$   $\rightarrow$  3.3k $\Omega$

Change: D801  
5.1V  $\rightarrow$  6.2V

Change: R728  
330 $\Omega$   $\rightarrow$  100 $\Omega$

Change: R734  
22k $\Omega$   $\rightarrow$  1k $\Omega$

